

Energy performance certificate (EPC)

94 BLAGDON ROAD
NEW MALDEN
KT3 4AE

Energy rating

D

Valid until: **4 January 2031**

Certificate
number: **0444-3002-0209-0849-9204**

Property type

Semi-detached house

Total floor area

84 square metres

Rules on letting this property

Properties can be let if they have an energy rating from A to E.

You can read [guidance for landlords on the regulations and exemptions \(https://www.gov.uk/guidance/domestic-private-rented-property-minimum-energy-efficiency-standard-landlord-guidance\)](https://www.gov.uk/guidance/domestic-private-rented-property-minimum-energy-efficiency-standard-landlord-guidance).

Energy efficiency rating for this property

This property's current energy rating is D. It has the potential to be B.

[See how to improve this property's energy performance.](#)

| Score | Energy rating | Current | Potential |
|-------|---------------|---------|-----------|
| 92+ | A | | |
| 81-91 | B | | 87 B |
| 69-80 | C | | |
| 55-68 | D | 56 D | |
| 39-54 | E | | |
| 21-38 | F | | |
| 1-20 | G | | |

The graph shows this property's current and potential energy efficiency.

Properties are given a rating from A (most efficient) to G (least efficient).

Properties are also given a score. The higher the number the lower your fuel bills are likely to be.

For properties in England and Wales:

- the average energy rating is D
- the average energy score is 60

Breakdown of property's energy performance

This section shows the energy performance for features of this property. The assessment does not consider the condition of a feature and how well it is working.

Each feature is assessed as one of the following:

- very good (most efficient)
- good
- average
- poor
- very poor (least efficient)

When the description says "assumed", it means that the feature could not be inspected and an assumption has been made based on the property's age and type.

| Feature | Description | Rating |
|---------|--|-----------|
| Wall | Solid brick, as built, no insulation (assumed) | Very poor |
| Wall | Solid brick, as built, insulated (assumed) | Good |
| Roof | Pitched, 250 mm loft insulation | Good |

| Feature | Description | Rating |
|----------------------|--|-----------|
| Roof | Pitched, insulated (assumed) | Good |
| Window | Fully double glazed | Average |
| Main heating | Boiler and radiators, mains gas | Good |
| Main heating control | Programmer, no room thermostat | Very poor |
| Hot water | From main system | Good |
| Lighting | Low energy lighting in all fixed outlets | Very good |
| Floor | Suspended, no insulation (assumed) | N/A |
| Secondary heating | None | N/A |

Primary energy use

The primary energy use for this property per year is 299 kilowatt hours per square metre (kWh/m²).

► [What is primary energy use?](#)

Environmental impact of this property

This property's current environmental impact rating is E. It has the potential to be B.

Properties are rated in a scale from A to G based on how much carbon dioxide (CO₂) they produce.

Properties with an A rating produce less CO₂ than G rated properties.

An average household produces

6 tonnes of CO₂

This property produces

4.4 tonnes of CO₂

This property's potential production

0.9 tonnes of CO₂

By making the [recommended changes](#), you could reduce this property's CO₂ emissions by 3.5 tonnes per year. This will help to protect the environment.


Environmental impact ratings are based on assumptions about average occupancy and energy use. They may not reflect how energy is consumed by the people living at the property.

Improve this property's energy performance

By following our step by step recommendations you could reduce this property's energy use and potentially save money.

Carrying out these changes in order will improve the property's energy rating and score from D (56) to B (87).

► [Do I need to follow these steps in order?](#)

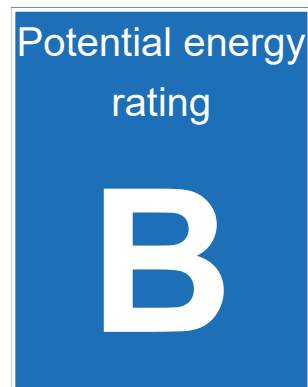

Step 1: Internal or external wall insulation

Internal or external wall insulation

Typical installation cost

£4,000 - £14,000

Typical yearly saving

£223

Potential rating after completing step 1

66 | D

Step 2: Floor insulation (suspended floor)

Floor insulation (suspended floor)

Typical installation cost

£800 - £1,200

Typical yearly saving

£48

Potential rating after completing steps 1 and 2

68 | D

Step 3: Heating controls (room thermostat and TRVs)

Heating controls (room thermostat and TRVs)

Typical installation cost

£350 - £450

Typical yearly saving

£79

Potential rating after completing steps 1 to 3

72 | C

Step 4: Replace boiler with new condensing boiler

Condensing boiler

Typical installation cost

£2,200 - £3,000

Typical yearly saving

£47

Potential rating after completing steps 1 to 4

74 | C

Step 5: Solar water heating

Solar water heating

Typical installation cost

£4,000 - £6,000

Typical yearly saving

£30

Potential rating after completing steps 1 to 5

76 | C

Step 6: Replacement glazing units

Replacement glazing units

Typical installation cost

£1,000 - £1,400

Typical yearly saving

£30

Potential rating after completing steps 1 to 6

77 | C

Step 7: Solar photovoltaic panels, 2.5 kWp

Solar photovoltaic panels

Typical installation cost

£3,500 - £5,500

Typical yearly saving

£345

Potential rating after completing steps 1 to 7

87 | B

Paying for energy improvements

[Find energy grants and ways to save energy in your home. \(https://www.gov.uk/improve-energy-efficiency\)](https://www.gov.uk/improve-energy-efficiency)

Estimated energy use and potential savings

Estimated yearly energy cost for this property

£942

Potential saving

£458

The estimated cost shows how much the average household would spend in this property for heating, lighting and hot water. It is not based on how energy is used by the people living at the property.

The potential saving shows how much money you could save if you [complete each recommended step in order](#).

For advice on how to reduce your energy bills visit [Simple Energy Advice \(https://www.gov.uk/improve-energy-efficiency\)](https://www.gov.uk/improve-energy-efficiency).

Heating use in this property

Heating a property usually makes up the majority of energy costs.

Estimated energy used to heat this property

| Type of heating | Estimated energy used |
|-----------------|-----------------------|
|-----------------|-----------------------|

| | |
|---------------|--------------------|
| Space heating | 12191 kWh per year |
|---------------|--------------------|

| | |
|---------------|-------------------|
| Water heating | 2143 kWh per year |
|---------------|-------------------|

Potential energy savings by installing insulation

| Type of insulation | Amount of energy saved |
|--------------------|------------------------|
|--------------------|------------------------|

| | |
|-----------------------|-------------------|
| Solid wall insulation | 4311 kWh per year |
|-----------------------|-------------------|

Contacting the assessor and accreditation scheme

This EPC was created by a qualified energy assessor.

If you are unhappy about your property's energy assessment or certificate, you can complain to the assessor directly.

If you are still unhappy after contacting the assessor, you should contact the assessor's accreditation scheme.

Accreditation schemes are appointed by the government to ensure that assessors are qualified to carry out EPC assessments.

Assessor contact details

Assessor's name

Stephen Jeatt

Telephone

07375567066

Email

stephen.jeatt@icloud.com

Accreditation scheme contact details

Accreditation scheme

Elmhurst Energy Systems Ltd

Assessor ID

EES/020404

Telephone

01455 883 250

Email

enquiries@elmhurstenergy.co.uk

Assessment details

Assessor's declaration

No related party

Date of assessment

4 January 2021

Date of certificate

5 January 2021

Type of assessment

▶ [RdSAP](#)

Other certificates for this property

If you are aware of previous certificates for this property and they are not listed here, please contact us at dluhc.digital-services@levellingup.gov.uk or call our helpdesk on 020 3829 0748 (Monday to Friday, 9am to 5pm).

There are no related certificates for this property.